



Gibraltar Maritime Administration

HM Government of Gibraltar

Watergate House
2/8 Casemates Square
Gibraltar

Tel (+350) 200 46862 / 200 47771
Email maritime.survey@gibraltar.gov.gi
maritime.registry@gibraltar.gov.gi

Shipping Information Notice – 122 CISR Safety Flyer Yachts – Pilot Boarding

To: Ship Owners, Operators, Master's and Classification Societies

References:

- Maritime Authority of the Cayman Islands - Flyer to the yachting industry 02/2025 – Pilot Boarding Arrangements

1. Introduction

- 1.1. Following concerns from Maritime Pilots and Port State Authorities in relation to potentially hazardous pilot boarding arrangements encountered on yachts, the Maritime Authority of the Cayman Islands have published Flyer to the yachting industry 02/2025.
- 1.2. Flyer 02/2025 highlights and provides visual examples of hazardous pilot boarding arrangements.
- 1.3. It further emphasizes, that the Safety of Life at Sea (SOLAS) Convention, Chapter V, Regulation 23 "Pilot Transfer Arrangements", applies not only to yachts subject to compliance with the SOLAS Convention, or the REG Yacht Code and previous iterations (LY2 etc) but to all vessels "*engaged on voyages in the course of which pilots may be employed*" which includes pleasure yachts not engaged in trade (non-commercial).
- 1.4. The intention of this Shipping Information Notice (SIN) is to promulgate flyer 02/2025 to owners, operators, and crew of Gibraltar registered vessels, with recipients encouraged to further distribute to other potentially interested parties.

2. Application

- 2.1. All Gibraltar registered yachts.
 - 2.1.1. Owners and operators of existing vessels, including those that are not certified in compliance with SOLAS Chapter V, Regulation 23, or the REG Yacht Code or previous iterations, should check that their arrangements are in closest possible compliance.
 - 2.1.2. Owners and operators of new build yachts should ensure suitably compliant pilot transfer arrangements are taken into consideration during the design stage.

Steve Gomez – Chief Surveyor
For & on behalf of the Maritime Administrator

Issue date: 09 July 2025

All notices are available through www.gibraltarship.com

This Shipping Information Notice has been issued electronically and does not carry a signature or official stamp. A signed and stamped copy is available upon request.

FLYER TO THE YACHTING INDUSTRY (02/2025)

Pilot Boarding Arrangements

Pilot boarding arrangements for pleasure yachts are coming under increased scrutiny.

SOLAS V/23 – ‘Pilot Transfer Arrangements’ applies to **ALL** “ships engaged on voyages in the course of which pilots may be employed.” This includes vessels not subject to ‘SOLAS surveys’, such as pleasure yachts not engaged in trade (i.e. pleasure yachts in private use).

A pilot may refuse boarding, thus preventing the vessel’s entry into port, and the Port State authority may take enforcement action (i.e. a detention or fine). The most common criteria for compulsory pilotage is >500 GT or >70 metres LOA, but it may be as low as 300GT or 30m LOA in some ports.

This Administration has received communications from pilots and Port States highlighting their concerns surrounding potentially dangerous arrangements on yachts. As such, in 2024 we undertook an enhanced inspection campaign of pilot boarding arrangements of Cayman flagged yachts, both commercial and private.

The International Maritime Pilot’s Association (IMPA) [2024 Safety Campaign Results](#) only 7 superyachts but of this small sample 50% were non-compliant with the regulations and/or the current IMPA ‘[Pilot Ladder Poster](#)’.

Additionally, SuperyachtNews in collaboration with CHIRP Maritime have been raising awareness; see <https://www.superyachtnews.com/operations/chirp-report-unsafe-pilot-transfer-arrangements>

Common issues with yachts include: -

1. Pilot ladder rigged from the deckhead.
2. No vertical hand holds.
3. Rubbing rail obstructions preventing the ladder steps from resting firmly against the ship’s side.
4. Pilot boarding stations not within the parallel body length of the ship.
5. Fittings not appropriately approved and tested, or unapproved modifications being made to ladders.
6. No suitable means available to adjust ladder length.

In December 2024, IMO’s Maritime Safety Committee (MSC) at its 109th session approved draft amendments to SOLAS regulation V/23 on *Pilot Transfer Arrangements* and the associated draft resolution on performance standards for pilot transfer arrangements. It is expected that these will be adopted at MSC 110 (June 2025) with an entry into force date of 1 January 2028. Some key amendments are that the rigging of the pilot ladder from the deckhead is specifically identified as not being permitted, the securing arrangements will have to meet a higher breaking load, and any means of securing a pilot ladder at intermediate lengths is to be type approved.

Following consultation with the UK Maritime Pilots Association, alternative arrangements for vessels less than 500GT were incorporated in the new revision of the [Red Ensign Group \(REG\) Yacht Code 2024](#) but these only effect the provision of ‘manropes’ and the required length of the ladder. For vessels being built under Cayman Registry supervision for compliance with the REG Yacht Code, designers/builders will be required to submit their Pilot Boarding Arrangements for review to ensure that they are fit for purpose.

Owners and operators of existing vessels, including those that are not certified in compliance with the REG Yacht Code or previous iterations, should check that their arrangements are in closest possible compliance,

primarily to ensure the safety of pilots but also to mitigate the risk of a pilot refusing to board and local authorities taking enforcement action.

Any questions or queries should be sent to technical@cishipping.com.

Typical examples of deficiencies



Improper securing of pilot ladders to handrails or fender saddles, no vertical handholds



Pilot ladder secured to deckhead (prohibited from 01.01.2028), no vertical handholds, rubbing rail obstruction (albeit relatively minor in this instance)